

Federal Department of the Environment, Transport, Energy and Communications DETEC

#### **Federal Office of Civil Aviation FOCA**

Safety Division - Aircraft

Swiss Confederation

	Lufttüchtigkeitsanweisung (LTA) Consigne de Navigabilité (CN) Direttive sulla Navigabilità (DN) Airworthiness Directive (AD)		FOCA AD HB-2012-002
	Inkraftsetzung Mise en vigueur Entrata in vigore Effective Date	17 July 2012	Pilatus – PC-21 FOCA TC/TCDS No: F 56-35

Issue Date: 10 July 2012

ATA Chapter: ATA 31 – Indicating/Recording Systems

Subject: Indicating/Recording Systems – Suspected Unreliable Airspeed –

Airplane Flight Manual (AFM) Temporary Revision (TR)

Supersedure / Revised

AD(s):

Not applicable

Type Certificate Holder's Name:

Pilatus Aircraft Ltd.

Manufacturer(s): Pilatus Aircraft Ltd.

Applicability: Model PC-21 aircraft, Manufacturer Serial Numbers (MSN) 101 through

MSN 154 inclusive.

**Reason:** This Airworthiness Directive (AD) is prompted due to occurrences during

flight where false Indicated Air Speed (IAS) were reported. The most probable cause for wrong IAS is related to obstruction of the pitot line caused by significant quantities of water, which becomes ice when the aircraft operates in low ambient temperatures. The ingress of water is believed to occur in heavy rain and/or during washing of the aircraft.

This condition, if not corrected, could result in a false IAS indication which also effects the operation of the Trim Aid Device (TAD), the Power Management System (PMS) and the Secondary Flight Display's (SFD) Attitude and IAS. Further this condition could cause an incorrect over speed warning and unreliable Angle of Attack (AOA) indication if indicated Mach is > 0.41. All the above constitutes an unsafe condition, particularly for aircrew unaware of the full effects (defined above) of a false IAS indication.

As an interim measure, FOCA AD HB-2012-002 requires the introduction of new Emergency Procedures for suspected unreliable airspeed by inserting a new Temporary Revision into the AFM.

As a terminating action, Pilatus PC-21 Service Bulletin No. 34-005 will be required to be implemented.

Required Action(s) and Compliance Time(s):

Required as indicated below, unless already accomplished:

Before next flight, after the effective date of this AD, insert Temporary Revision: 15-TR-83, Document: 21-B-15-00-00-69A-010A-A, into the AFM in front of Aircrew Information – General – List of Temporary Revisions (LOTR).

Lufttüchtigkeitsanweisung (LTA) Consigne de Navigabilité (CN) Direttive sulla Navigabilità (DN) Airworthiness Directive (AD)

#### FOCA AD

## HB-2012-002

(2) Before 31 December 2012, modify the aircraft according to Pilatus PC-21 Service Bulletin No. 34-005.

## Ref. Publication(s):

PILATUS PC-21 Temporary Revision: 15-TR-83, Document: 21-B-15-00-00-69A-010A-A, initial issue, dated 22 June 2012.

PILATUS PC-21 Service Bulletin No. 34-005, to be issued in the near future.

The use of later approved revisions of these documents is acceptable for compliance with the requirements of this AD.

# For further information contact:

The applicable manufacturer's documentation may be obtained directly from:

PILATUS AIRCRAFT LTD. Customer Technical Support (MCC) P.O. Box 992 CH-6371 Stans, Switzerland

Tel.: +41 (0)41 619 67 74 Fax: +41 (0)41 619 67 73

 $E\text{-mail: }\underline{\text{Techsupport@pilatus-aircraft.com}}$ 

For further information contact:

FEDERAL OFFICE OF CIVIL AVIATION (FOCA)
Design and Production (STEH)
CH-3003 Bern, Switzerland

Fax: +41 (0) 31 322 59 18 E-mail: <u>airdir@bazl.admin.ch</u>