



Lufttüchtigkeitsanweisung (LTA) Consigne de Navigabilité (CN) Direttive sulla Navigabilità (DN) Airworthiness Directive (AD)		FOCA AD HB-2010-005
Inkraftsetzung Mise en vigueur Entrata in vigore Effective Date	12 February 2010	Pilatus – PC-7 MkII FOCA TC/TCDS No: F 56-25

Issue Date: 29 January 2010

ATA Chapter: ATA 53 – Fuselage

Subject: **Fuselage – Forward Electrical Bonding Points – Inspection**

Supersedure / Revised AD(s): Not applicable

Type Certificate Holder's Name: Pilatus Aircraft Ltd.

Manufacturer(s): Pilatus Aircraft Ltd.

Applicability: Model PC-7 MkII aircraft, Manufacturer Serial Numbers (MSN) 010, MSN 101 through MSN 160, MSN 601 through MSN 604, MSN 608 through MSN 616 and MSN 675 through MSN 684 inclusive.

Reason: This Airworthiness Directive (AD) is prompted due to the discovery of corrosion at the bonding strap connections on the left and right lower longerons between fuselage frames 1 and 1A. The possibility of corrosion is increased because of the high electrical current flow between the tinned copper terminal lug of the bonding strap and the aluminum longeron.

Such a condition, if left uncorrected, could lead to failure of the longeron and will prejudice the structural integrity of the aircraft.

In order to correct and control the situation, this AD requires a one time inspection of the longeron structure and the terminal lugs of the bonding straps for signs of corrosion.

Required actions(s) and Compliance Time(s): Required as indicated below, unless already accomplished:

- (1) Within the next 120 days after the effective date of this AD, perform a visual inspection of the forward bonding points and the terminal lugs for signs of corrosion as required by paragraph (§) 3.C.(1), (2) & (3) of PILATUS PC-7 MkII Service Bulletin No. 53-012.
- (2) If during the inspection required by § (1) of this AD, any signs of corrosion are found, prior to further flight, perform the corrective actions according the instructions provided by § 3.D. of PILATUS PC-7 MkII Service Bulletin No. 53-012. If the corrosion damage is out of limits, record the values and apply to Pilatus for a repair scheme.

Note 1: The repeat inspections will be included in the Chapter 05 of the Aircraft Maintenance Manual (AMM).

Lufttüchtigkeitsanweisung (LTA)
Consigne de Navigabilité (CN)
Direttive sulla Navigabilità (DN)
Airworthiness Directive (AD)

FOCA AD
HB-2010-005

Ref. Publication(s): PILATUS PC-7 MkII Service Bulletin No. 53-012, initial issue.

The use of later approved revisions of this document is acceptable for compliance with the requirements of this AD.

For further information contact: The applicable manufacturer's documentation may be obtained directly from:

PILATUS AIRCRAFT LTD.
Customer Technical Support (MCC)
P.O. Box 992
CH-6371 Stans, Switzerland

Tel.: +41 (0)41 619 33 03 Fax: +41 (0)41 619 67 73
E-mail: Techsupport@pilatus-aircraft.com

For further information contact:

FEDERAL OFFICE OF CIVIL AVIATION (FOCA)
Design and Production (STEH)
CH-3003 Bern, Switzerland

Fax: +41 (0) 31 322 59 18
E-mail: airdir@bazl.admin.ch